

<u>Service Report</u>	██ School Sales Order # ██████████
Service Date	██████████
Authorization	██████████
Equipment Type	██
Condition System Found In	Ready to be commissioned except for floor HHR receptacle missing because of parts delay.
Work Performed	Inventoried all equipment, inspected all stations and racks. Checked the dimmer racks and powered up – very neat LV wiring. Checked ██████████ network wiring and addressed stations. Powered up and ok. Checked out then powered up SMP panel. Checked out HHR and DMX receptacles. Programmed ██████████ and half the stations would work. Re-checked disconnect switches and OK. After much testing the last station tested that was in the SMP panel was determined to have a probable fault. If it is hooked up the entire system fails; it is not hooked up all other stations work correctly. Powered up the ██████████ series console and it would not boot up. Turned it around to double check the RJ45 wiring between panels and heard rattling parts. Discovered what panel it was and removed 1 each of the following: screw, washer, interconnection lock. Removed and console fully booted up. Performed training session; it was video taped by the EC.
Closing	██ ██ ██
Engineer	Maurice Garcia 